



EPA Refrigerant Conservation Services Report



Customer: DuPont Experimental Station

Date: 03/13/2017

Location: E315 Powerhouse

Equipment Type:	
Industrial Process / Com. Refrigeration	
Commercial - Over 50 lbs Refrigerant	<input checked="" type="checkbox"/>
Commercial-Under 50 lbs Refrigerant	

Equipment ID: CHILLER #9

Refrigerant Leak Verification Test - 02/13/2017

Source of Leak: 1-1/2" THREADED PLUG ON LIQUID REFRIG TEE FEEDING OIL COOLER. (MEDIUM)

Corrective Action: Replaced Plug w/ Bushing & 3/4" Ball Valve. Used Loctite 554 Refrig. Thread Sealant (02/24/2017)

Source of Leak: COMPRESSOR SHAFT SEAL (MEDIUM) (4.975ml/hr Running Oil Leak Rate)

Corrective Action: Installed New Shaft Seal Components (Collar, Seal, Springs, O-Rings) (02/21/2017)

Source of Leak: _____

Corrective Action: _____

Initial Leak Verification Test : Pass Failed

Was Leak Repaired? Yes No Owner Declined Repair

Verification Test Method: Electronic Detector & Soap Bubbles (120psig Nitrogen Pressure w/R-134a Trace)

Refrigerant Usage Recovered Refrigerant Re-Charged to Chiller - 02/28/2017

Refrigerant Type: (Circle One) R-11 R-12 R-22 R-123 R-134a R-407c R-410a Other: _____

Refrigerant Lbs. Used: 100 lbs Factory Charge or Approximate Charge: 3,250 lbs

Refrigerant Supplied By: Customer JCI Other, Explain _____

Refrigerant Recovery 02/16/2017 (Technician Certification Cards on File at JCI Local Office)

Recovery Unit Model# YORK RTU-10 Serial # 61795205-91012424 Mfg. Date Before 11/15/93 Yes / No

Refrigerant Type: (Circle One) R-11 R-12 R-22 R-123 R-134a R-407c R-410a Other: _____

Refrigerant Re-Charged to Sys.? Yes No - 02/28/2017 Refrigerant Lbs. Recovered: 2,840 lbs

Refrigerant Not Re-Charged, Explanation: _____

Refrigerant Leak Rate Formula for Units Greater Than 50 Lbs

(100 lbs. Refrig. Added / 3250 lbs. in Full Charge) x (365 / Lesser of 365 Days or # of Days Since Refrig. Added) x 100

Refrigerant Leak Rate Percent: 3% Minimal refrigerant leaks were found.

Leak Rate found in excess of 15% 35% annual charge which exceeds legal EPA leak rates.

30-Day Refrigerant Follow-up Verification Test

Date Test Performed: 03/13/2017 Pass Failed

Comments: Verified w/ Electronic Detector & Soap Bubbles (Chiller Pressure @ 60psig). After charge installed.

Additional Comments: Chiller #9's current charge is 2,940 lbs. This is 310lbs below design. There is no longer any surplus charge in the York Central Recovery Tank. Chiller performance is currently Normal despite this deficit. Recommend purchasing additional R-134a.

Technician Signature: [Signature]

Customer Signature: _____