

Title: 17/19DR OIL FILTER DAMAGE

Number: C8805

Date: 4/28/88

Supersedes: NEW

Date:

Models Affected: 17/19DR

PURPOSE

This bulletin provides information and recommendations regarding the replacement of damaged oil filters on 17/19DR centrifugal water chillers.

BACKGROUND

As of the date of this bulletin, it was discovered in the factory that some of the 17/19DR oil filters were being burned at the end where the oil enters and leaves the housing. The filters were not being removed from the filter housing prior to brazing the oil lines. All chillers presently in the plant are being reworked to check for and replace any burned filters.

RECOMMENDATION

It is recommended that the oil filters on all 17/19DR units which were shipped prior to 4/28/88 be checked (and replaced if necessary) if they have not yet started up.

If an operating 17/19DR is opened up for any reason and the filter has not yet been replaced, the filter should be checked and replaced if necessary. If burned filters are found on operating 17/19DR's, please notify the writer.

MAIL KEYS: 2.45, 2.40B, 2.53, ISBH, 2.33D


FILE KEY: INSTALLATION - START-UP - OPERATION

Prepared By: _____



Lee Mount

Approved By: _____



James Cuny