



## SERVICE BULLETIN

---

**Title:** 3200MP EPROM Kit

**Models Affected:** All 3200MP Based Controls

**Number:** C9609A

**Date:** 3/26/96

**Supersedes:** C9609

**Date:** 2/27/96

### **Purpose:**

To inform the field of initialization errors with 3200MP EPROM kit part number 32MP660-016 shipped after November 1995.

File: Controls - Wiring

Prepared By: Paul A. Holsinger

Approved By: Alan M. Johnson

---

This document and the material contained herein are the property of Carrier Corporation and may not be copied, reproduced, or released without written permission of Carrier Corporation.

## Background:

Reports from the field have identified errors with the operation of 3200MP chips with part numbers HK98EZ101,111,121 purchased in December of 1995.

Specifically, problems are occurring with kits procured from RCD with an M/5 date code in the lower right corner of the white part label affixed to the carton by RCD. Testing has proven that the current stock in RCD date coded A/6 (January 1996) and later performs per specifications.

## Troubleshooting:

The following symptoms may occur:

1. Code 33 will be displayed on ESPII Panel and 88 will appear on Setpoint Display Panel.
2. Compressor may start when POR button is depressed or control power is cycled.

## Procedure:

Please check your inventory for any 32MP660-016 kits that have the M/5 date code in the lower right corner of the label. Any kits that have this date code are to be returned to RCD via your order correspondent and the RCD return material procedure referencing this bulletin number on the RM.

**IT IS RECOMMENDED THAT THE M/5 CODED SET OF EPROM'S NOT BE INSTALLED.**