



BY JOHNSON CONTROLS

Service Information

File In/With: N/A

SI0202

New

109

Equipment Affected: YPAL Mod "D" & "E"
Packaged Rooftop Units w/FlexSys

Software Update C.J05.01.06

General

We have identified the need for an additional modification to software version C.J00.01.06 used with the IPU control on the YPAL MOD D” and “E” Packaged Rooftop Units. The revised software will be identified as version C.J05.01.06 .

The latest version of the software will be available on the Johnson Portal on or before January 16, 2009. Refer to Service Information Letter SI0157 for the location of the software on the Portal and the procedure on how to download from the Portal and update the unit.

If the software version installed in the unit is ECO.01.01, you will have to update to ECO.01.02 before updating to C.J05.01.06 .

If version ECO.01.02, ECO.01.03, ECO.01.04, C.J09.01.04, C.J00.01.05, C.J00.01.06, or C.J04.01.06 is installed, you can go immediately to version C.J05.01.06 .

SOFTWARE ISSUES

The following is a summary of the changes contained in software version C.J05.01.06 :

PROBLEM – If a Flexsys unit was in the Occupied Stand By mode of operation, Supply Air Tempering would not function.

SOLUTION – The revised software allows Supply Air Tempering to function when the unit mode is in Occupied Stand By, Occupied Cooling with Bypass, or Occupied Cooling without Bypass.

Warranty

The above update only involves FlexSys unit with a heating option. Therefore we will only honor warranty claims for this category of equipment. Please reference Service Information Letter SI0202 in the Problem Description section of the claim.