
	FILE IN _____ SK _____ MANUAL(S).	
	SERVICE BULLETIN	Supersedes: Nothing
		File with Form: 160.65-OM1

SUBJ.: LOSING VAR. SET POINTS
ON THE 1250 TON SCREW

PROBLEM: On the 1250 ton screw chiller the panel loses its variable set points for no apparent reason.


SOLUTIONS: The problem is the U8 chip on the micro board. To resolve this problem you must replace the micro board. You will find below a drawing (footprint) of the defective chip. If the footprint is as shown below the chip is your problem.

FOOTPRINT (note the number starting with V62C5 and the circle with 9 dots)

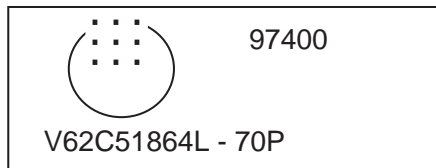

LD04142

LOCATION OF U8 CHIP ON THE MICROBOARD

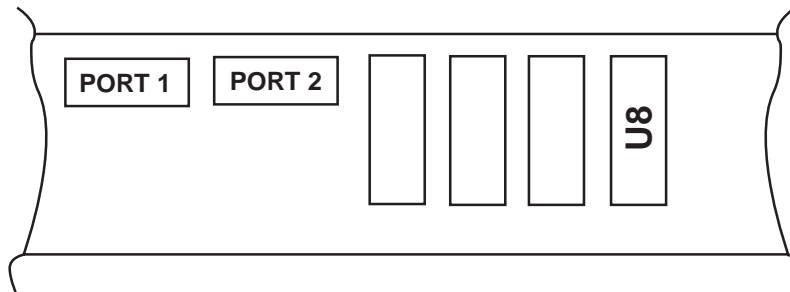

LD04143



Proud Sponsor
of the 2000
U.S. Olympic Team

36USC380