



**UNITED  
TECHNOLOGIES  
CARRIER**

**Commercial Division**  
Carrier Corporation

BULLETIN: CA-SB-17-70-13  
DATE: 5/22/70  
PAGE: 1 OF: 1

## SERVICE BULLETIN

SUBJECT: 17 SERIES OIL FILTERS/AA,BZ,CZ,DZ COMPRESSORS

SUPERSEDE  
BULLETIN:  
DATE:  
PAGE: OF:

Installation, repair and service and equipment referenced in this Service Bulletin should be undertaken only by qualified persons. Carrier Corporation (1) makes no representations or warranties, expressed or implied, concerning the accuracy, completeness or right to use the information contained herein, and (2) disclaims all liability for injuries, damages, infringements and other losses which may arise on account of, or which may result from, the use or application of any information, method or apparatus disclosed herein.

### PURPOSE

To advise that the existing replacement oil filter element (Carrier Part No. KH19BZ005) will not fit into the old style 17 Series AA,BZ, CZ, and DZ seal oil reservoirs.

### MACHINES AFFECTED

17 Series AA,BZ,CZ, and DZ compressors.


### BACKGROUND

The filter for the 17 Series AA,BZ,CZ, and DZ compressors required a threaded spud which screws into the reservoir casting.

The present replacement oil filter (Carrier Part No. KH19BZ005) is used on both the AA,BZ,CZ,DZ and the 17M,P,S seal oil reservoir. This element does not have the necessary threaded spud connection on the bottom of the filter cartridge. The 17M,P,S seal oil reservoirs contain a non-threaded hole which is larger than the threaded hold in the old AA,BZ,CZ and DZ types. The present cartridge, therefore, will not fit the present AA, BZ,CZ and DZ oil reservoirs.

### PROCEDURE

When an oil filter element for the old style AA,BZ,CZ and DZ needs replacement, order Part No. 17B2-005. This filter has the threaded spud which will fit easily into the connection in the oil reservoir.

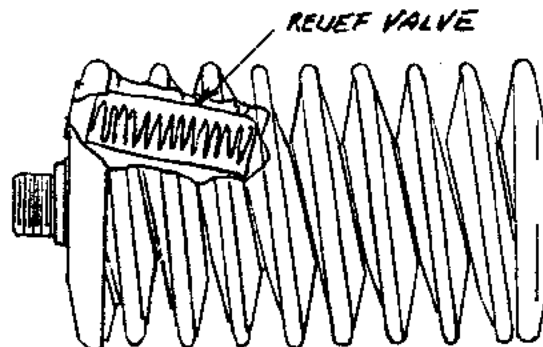

PART NO. 17B2005